Fixes and Enhancements PTC Creo Elements/Direct® Modeling 19.0 M050

Please find below the list of fixes and enhancements - as of June 15th, 2016 - that have been implemented for PTC Creo Elements/Direct Modeling and PTC Creo Elements/Direct 3D Access 19.0 M050.

IMPORTANT NOTE for 19.0 M050:

19.0 M050 is supported on 64 Bit Windows 10 Operating System with a limitation captured below:

Following Import and Export translators are not supported on Windows 10:

- PTC Creo Elements/Direct Interface for ACIS (.SAT)
- > PTC Creo Elements/Direct Interface for SolidWorks Parasolid (.X_T, .X_B)
- PTC Creo Elements/Direct Interface for Solid Edge Parasolid (.X T)
- PTC Creo Elements/Direct Interface for NX Parasolid (.XMT_TXT, .X_T)
- PTC Creo Elements/Direct Interface for IDEAS (.ANF-IDEAS, ANF)
- > PTC Creo Elements/Direct Interface for UG (.ANF-UG, ANF)
- PTC Creo Elements/Direct Interface for Creo Parametric V1.0 and below (ANF-PROE, ANF)

| Customer Case | Description | Module | Version |
|------------------|---|-----------------------------------|-----------|
| 2069574 | module name needs to an example program in I-KIT manual | 3D Documentation | 19.0 F000 |
| 2098574 | Lower graphical performance (seems to be an endlessloop) when double clicking a 3D documentation plane | 3D Documentation | 19.0 F000 |
| 2147964 | Start sequence of 3D Documentation is wrong. The "d3d_avail_cmds.cmd" file should be loaded first and then the "d3d_customize" file. The load sequence must be changed. | 3D Documentation | 19.0 F000 |
| 2162112 | In Inspection module, if a docuplane is chosen as "preparation", Modeling will be shut down compulsorily (Windows 7 only). | Advanced Design Inspection | 19.0 F000 |
| 2104518 | Outline command in Mold Design doesn't work correctly with the specific part | Advanced Design Mold Design | 19.0 F000 |
| 2152925 | Load and boundary definitions Creo-Simulate-Definitionen are suppressed when study is updated in Creo Elements/Direct Modeling | Advanced Mechanica | 19.0 F000 |
| 1610393 | Missing hidden thread lines with Classic Update - Graphical Update is OK | Annotation | 19.0 F000 |

Copyright © 2016 PTC Inc.

| 1619920 | Annotation: View labels jump due to an update | Annotation | 19.0 F000 |
|---------|--|------------|-----------|
| 1630237 | Tangential dimension not working correctly. Diameter dimension using option tangential not working when inch is used as unit | Annotation | 19.0 F000 |
| 1979747 | When using the Annotation BOM functionality with inseparables in the assembly, it does not display the inseparable assemblies in the BOM. See attached document and bundle file. Data that should be in the bom is missing, leading to an incorrect BOM. related subcall - 7682680 | Annotation | 19.0 F000 |
| 1980089 | Thread circles are not displayed correctly for UNC and NPT threads | Annotation | 19.0 F000 |
| 1990808 | section view not aligned anymore after update | Annotation | 19.0 F000 |
| 1994721 | Attach Drawing not possible because of wrong error message -> open whether the SPR is just about an wrong error message or about an failed AttachDrawingtoTrueCopy > checking with customer | Annotation | 19.0 F000 |
| 2008625 | Default Settings: Top node styles like JIS, DIN cannot be deleted with (oli::sd-delete-settings-style "Annotation" :DIN :forced t) entered in am_customize file. | Annotation | 19.0 F000 |
| 2037958 | Inseparables do not show up in Annotation BOM at all | Annotation | 19.0 F000 |
| 2048688 | After View Update: BOM flags will be lost after a drawing has been attached as "True Copy" to an instance of the original assembly | Annotation | 19.0 F000 |
| 2051308 | At times edges created by chamfers will be displayed in 2d drawings as tangent lines (by default shown in green) instead of normal white geometry lines. In the attached example the problem shows up on sections views taken from a cylindrical part and appears to be related to a low angle of incidence between the chamfer face and the original face. | Annotation | 19.0 F000 |
| 2051671 | View update of a dedicated bundle file will change the contour of a defined section line | Annotation | 19.0 F000 |
| 2051972 | Moving a Detail View to another Sheet results in a Reset of the Detail Label Position and Text | Annotation | 19.0 F000 |
| 2052402 | When create chamfer dimension, the error "sigsegv" occurs. | Annotation | 19.0 F000 |
| 2055287 | tangential diameter dimension wrong | Annotation | 19.0 F000 |
| 2055397 | Hidden hatches become visible after update | Annotation | 19.0 F000 |
| 2056723 | Missing lines in partial view of section view | Annotation | 19.0 F000 |
| 2057877 | The command that cannot be used on the mini toolbar is displayed. (Stagger Line command for Angle dimension) | Annotation | 19.0 F000 |
| 2058737 | Fonts are not translated correctly during DXF/DWG export, if the font has been changed in the current session | Annotation | 19.0 F000 |
| 2060537 | Docuplane Section Name Not Regarded in Annotation For Section Docuplanes With Subdocuplane Partial | Annotation | 19.0 F000 |
| 2064104 | New chamfer dimension behavior in Annotation 17 doesn't work correctly with specific model data. | Annotation | 19.0 F000 |
| 2066527 | All OLE objects (except for the last one) are lost if saving a drawing from v17 into an earlier version. | Annotation | 19.0 F000 |
| 2067305 | Customer deleted a view label and saved their drawing - losing the view label. There is not currently a workaround. If customer goes to modify the view label they get a low level warning: The selected text is a view label. It should be modified by changing the properties of views. Users got no such warning if they delete the view label and they should. | Annotation | 19.0 F000 |
| 2067316 | When trying to select calculated geometry or centre lines when dimensioning to an element that also has a coincident staggered section line - the selection jumps to another point on the staggered | Annotation | 19.0 F000 |

| | section line. This issue is a regression from release 16.50 and previous behaviour. | | |
|---------|--|------------|-----------|
| 2071269 | When updating a view pos-flags, section lines and detail borders will be moved | Annotation | 19.0 F000 |
| 2071284 | Missing lines after view update | Annotation | 19.0 F000 |
| 2073197 | thread lines will be displayed depending on the orientation of the section line | Annotation | 19.0 F000 |
| 2073692 | Wrong chamfer dimension in 2D view. | Annotation | 19.0 F000 |
| 2074877 | When you move the mouse-pointer over a hatch; the hatch is rebuild very slowly. | Annotation | 19.0 F000 |
| 2075310 | Update of specific view leads to SigSegV | Annotation | 19.0 F000 |
| 2075762 | When update by classic mode, the result is wrong. | Annotation | 19.0 F000 |
| 2076596 | Hatch won't be calculated in cutaway | Annotation | 19.0 F000 |
| 2078782 | Annotation update aborts with empty part message | Annotation | 19.0 F000 |
| 2079001 | A view update of a dedicated pkg-MI file will cause the Modeling process to suspend | Annotation | 19.0 F000 |
| 2079142 | Annotation update aborts | Annotation | 19.0 F000 |
| 2079704 | some screw thread lines are missing in broken views | Annotation | 19.0 F000 |
| 2080293 | Undo+Redo after a drawing update leads to SW crash | Annotation | 19.0 F000 |
| 2081354 | Annotation: View cannot be updated after true copy of drawing was attached | Annotation | 19.0 F000 |
| 2082189 | Cannot store the drawing to Model Manager via LISP error "NIL cannot be coerced to a VECTOR3". It's caused if the pen transformation is removed from 'True Color' in Annotation. | Annotation | 19.0 F000 |
| 2083366 | When deleting a centre line of a slot in Annotation the Modeling process will be suspended | Annotation | 19.0 F000 |
| 2083486 | When move the front (and back) view, some dimensions remained | Annotation | 19.0 F000 |
| 2084692 | Some hidden lines appear after update | Annotation | 19.0 F000 |
| 2085559 | Annotation - views incomplete after graphical view update | Annotation | 19.0 F000 |
| 2086502 | Thread lines missing after view update | Annotation | 19.0 F000 |
| 2090898 | chamfers at Countersunk Through Holes drilled into a cylinder can not be dimensioned in Annotation | Annotation | 19.0 F000 |
| 2091219 | Invalid Dimension in a broken Section View | Annotation | 19.0 F000 |
| 2092086 | Thread lines for threads defined as Outer Thread (Clearance) are not displayed in an Annotation drawing | Annotation | 19.0 F000 |
| 2092948 | Edited dimensions will cause the iges translation process in Creo Elements/Direct Modeling - Annotation to become unresponsive | Annotation | 19.0 F000 |
| 2094683 | How to enter an Upper/Lower tolerance in Creo Elements/Direct Modeling - Annotation | Annotation | 19.0 F000 |
| 2094832 | Update result is not correct (depend on data problem). One line has angle when split it by other part. | Annotation | 19.0 F000 |
| 2095037 | Annotation drawing updates incorrectly, dimension now anchors to different location after update which changes the dimension value, but does not change any other visible references on the model - appears to the customer like a silent failure in our software. | Annotation | 19.0 F000 |
| 2095103 | Creo Elements/Direct Modeling - Annotation becomes unresponsive when deleting recreated center lines | Annotation | 19.0 F000 |
| 2097042 | View update in Creo Elements/Direct Modeling - Annotation will cause segmentation violation | Annotation | 19.0 F000 |
| 2097043 | Some edges are missing in the drawing when view calc mode is | Annotation | 19.0 F000 |

| | classic and econofast is OFF. | | |
|---------|--|------------|-----------|
| 2097252 | Cannot save a drawing as a DXF or DWG in annotation if the drawing contains a shaded view. | Annotation | 19.0 F000 |
| 2103036 | am_create_standard_view/signal/sigsegv. When create view, error occurred. The problem occurred only Simplified Chinese 18.0 M010. English or Japanese are no problem. The problem is not dependent on the data | Annotation | 19.0 F000 |
| 2103227 | Hidden lines of embossing are not always created in Creo Elements/Direct Modeling 17.0 Annotation | Annotation | 19.0 F000 |
| 2103915 | When updating the drawing forcibly, the edited chamfer dimension's position changes and ++edited++ is added to the dimension value. If you do the same thing in 15.50, there's no problem. | Annotation | 19.0 F000 |
| 2103939 | In 17.0, some coordinate dimensions colored red after updating 15.50's drawing forcibly. | Annotation | 19.0 F000 |
| 2104173 | Some hatch is removed after updating the drawing forcibly. | Annotation | 19.0 F000 |
| 2104180 | When update the drawing which is created 15.5 on 17.0 by Forced Update, the hatches results are different. | Annotation | 19.0 F000 |
| 2104513 | Some hatching disappears and some elements are added by view update execution. | Annotation | 19.0 F000 |
| 2104800 | Hatching for section view is different between 15.50B and 17.00 after updating a view | Annotation | 19.0 F000 |
| 2104847 | Normal lines appear after updating forcibly in Modeling 17.00. The files are made by Modeling 15.50B. In Modeling 15.50B, these lines weren't generated. | Annotation | 19.0 F000 |
| 2105946 | Symline length are changed after updating forcibly | Annotation | 19.0 F000 |
| 2112203 | Back view of attached part does not update correctly when using Classic update mode, but does update correctly when using Graphics update mode. | Annotation | 19.0 F000 |
| 2112766 | Serious performance issue when using Annotation's Part Color command interactively to change the color of all parts of a huge assembly | Annotation | 19.0 F000 |
| 2113917 | Thread dimension value disappears during update | Annotation | 19.0 F000 |
| 2117590 | Reference Line's position changes after updating the specific drawing forcibly | Annotation | 19.0 F000 |
| 2118028 | Wrong thread declaration in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2119939 | Dimension cannot be attached between a view and its sketch in Annotation | Annotation | 19.0 F000 |
| 2120333 | Unclear spelling of the view profile option :remove-parts-mode in the am_customize file | Annotation | 19.0 F000 |
| 2125496 | Using "Stagger dimension line" causes system hang if 2 dimension lines (actually extension lines) are located on the same place | Annotation | 19.0 F000 |
| 2129059 | Update-to-date check during Annotation Save delivers only a warning instead of an error | Annotation | 19.0 F000 |
| 2129905 | Cannot attach a radius dimension with an extension line to an arc in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2130337 | When adding a thread dimension to the thread circle, the value of dimension is wrong. | Annotation | 19.0 F000 |
| 2130644 | Tap depths for metric threads are shown in MM even though the dimension style is INCH. | Annotation | 19.0 F000 |
| 2131253 | In Annotation views can be deleted with the DEL key but does not work for flat views | Annotation | 19.0 F000 |
| 2131291 | Undo/Redo Submenu vanishes if new Icon being added to Quick Access Toolbar in Annotation and Annotation restarted | Annotation | 19.0 F000 |

| 2131524 | Update after assign to variant - receive signal segmentation violation - same behaviour seen in 18.1 F000 | Annotation | 19.0 F000 |
|---------|---|------------|-----------|
| 2132548 | Unable to load a valid MI file (*.mi) into Annotation if there is a single quote (apostrophe) somewhere in the full path to the file. | Annotation | 19.0 F000 |
| 2134708 | Screen transformation within customizations will be overwritten by Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2136958 | Unable to update view in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2137641 | RMB Menu will open in Annotation when Zooming with CTRL-RMB in own application context and or Window redraw delayed forcopilot information tab | Annotation | 19.0 F000 |
| 2138635 | Since the switch (docu-cmd "DIM_RAD_NEVER_WITH_ARC_EXTENSION ON") is built in, dimension lines always point to invisible arc/spline extensions but not to the geometry. | Annotation | 19.0 F000 |
| 2139843 | Dimensions across broken views will show wrong values in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2143967 | When deleting MathCad OLE in Creo Elements/Direct Modeling Annotation becomes unresponsive | Annotation | 19.0 F000 |
| 2145149 | Annotation: Edit thread dimension with two single quotation marks is not possible | Annotation | 19.0 F000 |
| 2145615 | When performing a view update of a section view Creo Elements/Direct Modeling becomes unresponsive | Annotation | 19.0 F000 |
| 2145703 | Error occurs when creating a partial view out of a section view in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2147724 | DXF file will not load into 18.0, 18.1, 19.0 but loads fine in 17.0 | Annotation | 19.0 F000 |
| 2148997 | Drawing gets corrupted after view update and saving it in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2149201 | Reloading a drawing will corrupt its data structure in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2153716 | When placing a Datum using Datum ISO/DIN, it uses the default refline which it shouldn't. See attached for example. | Annotation | 19.0 F000 |
| 2156398 | [regression] Not able to align a tangential dimension horizontally (RMB) | Annotation | 19.0 F000 |
| 2156467 | Modeling has stopped working when updating a view in Annotation | Annotation | 19.0 F000 |
| 2157431 | Wrong dimension in section view when parent is a section view of a broken view and calculation of previous sections are set to NO | Annotation | 19.0 F000 |
| 2157751 | Label of detail in parent view will move during view update in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2157885 | Low performance when using workplanes with lot of geometry in Annotation | Annotation | 19.0 F000 |
| 2158975 | If section view has correct position the angle is measure incorrectly. If section view is rotated by 90 degrees, the angle is measured correctly. | Annotation | 19.0 F000 |
| 2159566 | Low performance when updating a view in Annotation | Annotation | 19.0 F000 |
| 2160142 | When performing a graphical view update with certain drawings Annotation will become unresponsive | Annotation | 19.0 F000 |
| 2161510 | Modeling stopped working when updating a detailed view | Annotation | 19.0 F000 |
| 2166098 | Position of the border line in broken views will lead to wrong dimensions in Annotation (production problems due to this issue) | Annotation | 19.0 F000 |
| 2167229 | Completely wrong dimensions in section view containing broken view in Annotation. The parent view is a regular orthogonal view. | Annotation | 19.0 F000 |
| 2176900 | Drawing sheet information is missing in the CEDM adapter | Annotation | 19.0 F000 |

| 2180453 | View update performance is unacceptable when graphic+shaded | Annotation | 19.0 F000 |
|---------|---|--------------------------|-----------|
| 2186959 | calculation mode is used in Annotation Warning when deleting view labels has not been localized in Creo | Annotation | 19.0 F000 |
| 2187680 | Elements/Direct Modeling Regression: Export MI to DXF in AC1024 format destroys radius dimensions Every radius dimension with value X is translated to: \c16772096; R\c16772096; X | Annotation | 19.0 F000 |
| 2188750 | Update view leads to a Lisp error: NIL is not type of number | Annotation | 19.0 F000 |
| 2196053 | Thread hole is missing after view update in Creo Elements/Direct Modeling (regression) fix in v19 expected | Annotation | 19.0 F000 |
| 2201178 | OLE application list not complete on Win8 in Creo Elements/Direct Modeling | Annotation | 19.0 F000 |
| 2201578 | Creo Elements/Direct Modeling becomes unresponsive if view update in Graphics+Shaded mode will be performed | Annotation | 19.0 F000 |
| 2118309 | Need to have I Kit function enabling 2 Synchronized Viewports | Application Interface | 19.0 F000 |
| 2123913 | In Fluent-UI, docu-enable-view-set-button-box doesn't work because there is no "button box" in this UI. But the description is left in the help center. | Application Interface | 19.0 F000 |
| 2130480 | Documentation for command options that are no longer in the code. | Application Interface | 19.0 F000 |
| 2156538 | [regression] Browser tree update function called, even if the browser is not visible | Application Interface | 19.0 F000 |
| 2158041 | Activating Sheet Metal using the following Integration Kit commands will fail to load standard ribbon customization from CORP, SITE and USER customization directory: '- (oli:sd-module-activate "SHEETADVISOR") '- (ACTIVATE-SHEETADVISOR) | Application Interface | 19.0 F000 |
| 2173292 | Although in the i-kit documentation (sd-inq-edge-edge-dist edge1 edge2 :sf-space pspace) function is described with four parameters a lisp error occurs: the function requires two parameters but four were supplied | Application Interface | 19.0 F000 |
| 2174921 | DOCU_DEP_ELEM_LTAB deletes symbol when text is grouped to it | Application Interface | 19.0 F000 |
| 2184267 | sd-reset-display-table-filter should reset the filtering but the column header color remains red | Application Interface | 19.0 F000 |
| 2188413 | Misleading information concerning the command sd-is-pseudo-folder-node-p | Application Interface | 19.0 F000 |
| 1697593 | Blend Creation fails R=5 and option=OnSharpEdge - case 2 | Base Functionality | 19.0 F000 |
| 1944468 | Lineares Bewegen einer Flaeche fuehrt zu falschem Ergebnis (pbf issue) | Base Functionality | 19.0 F000 |
| 1950105 | Clash calculation failed. | Base Functionality | 19.0 F000 |
| 1986407 | It takes long time to the element selection in Move/Stretch. | Base Functionality | 19.0 F000 |
| 1989316 | Align Axis leads to a strange behaviour. Using dynamic operations the model starts flickering. | Base Functionality | 19.0 F000 |
| 2004108 | *Transition*A package file containing a single part > 3GB can be written but NOT been loaded | Base Functionality | 19.0 F000 |
| 2035384 | Cannot put a part ON the drawlist during an active command (MOVE) if Realistic Imaging is activated. | Base Functionality | 19.0 F000 |
| 2041728 | Function keys (like F5 and F6) do not work within the Position command | Base Functionality | 19.0 F000 |

| 2058059 | Contour->Project->General:Free Works only, if the Projected Edges are IN FRONT OF the Workplane | Base Functionality | 19.0 F000 |
|---------|--|-----------------------|-----------|
| 2061238 | Helix - Remove Material command leads to an endless loop | Base Functionality | 19.0 F000 |
| 2061820 | A blend with R=1 mm should be created. The creation fails because some affected blends cannot be recreated. | Base Functionality | 19.0 F000 |
| 2062855 | Clash Analysis detect wrong clashes when THREAD option is set to active | Base Functionality | 19.0 F000 |
| 2077836 | Select All at Top with Coordinate Sys 3D Objects filter set and nothing happens. Typically All at Top is greyed out with Coord Sys select Method set | Base Functionality | 19.0 F000 |
| 2080330 | Punch, only touching a part, creates an invalid result | Base Functionality | 19.0 F000 |
| 2082367 | *Transition* Lightweight Model Setting cause inseparable assemblies to be loaded without edges | Base Functionality | 19.0 F000 |
| 2088510 | Partial Load of specific Assembly takes 10 x longer than full load | Base Functionality | 19.0 F000 |
| 2088981 | In attached data, part A and part B are away. However the result is CLASH when execute clash command. | Base Functionality | 19.0 F000 |
| 2094531 | Analysis results for customer volume measurement off by 250% when reported error is 3.2% | Base Functionality | 19.0 F000 |
| 2099020 | Fixing the angle not working while using Lin/Arc 2D-CoPilot function on a workplane | Base Functionality | 19.0 F000 |
| 2100493 | Selecting large complex workplanes containing complex overlapping geometry causes Modeling to hang for some minutes. | Base Functionality | 19.0 F000 |
| 2100902 | ALIGN with OFFSET fails if the cylindrical reference face contains a bspline boundary | Base Functionality | 19.0 F000 |
| 2100904 | High Resolution Print (HR Print) fails with error message | Base Functionality | 19.0 F000 |
| 2104134 | Multiple Positioning in Copy Part/Assy and Share Part/Assy reacts extremely slow in a large assembly | Base Functionality | 19.0 F000 |
| 2104887 | Face part reports high negative volume and mass (Part Measure) | Base Functionality | 19.0 F000 |
| 2105125 | Reintegrate assigns "load as version" status to instances. Reintegrate is the only functionality which does that. All other functionality assigns "load as version" to the (shared) contents only. This is related to SPR 2105109. | Base Functionality | 19.0 F000 |
| 2108326 | Low Performance when copy a big assembly by using "Create Linear" in Part&Assy menu | Base Functionality | 19.0 F000 |
| 2108334 | Reintegrate fails with sigsegv error when the new part is empty | Base Functionality | 19.0 F000 |
| 2109127 | Floating Toolbars will appear on unique position after restart | Base Functionality | 19.0 F000 |
| 2110050 | The cursor changes the shape (rubber disappears) inside of the structure browser | Base Functionality | 19.0 F000 |
| 2113402 | Lisp error occurs if the axis point of spherical surface was specified as a face point of "Wrap on Surface". | Base Functionality | 19.0 F000 |
| 2113528 | Mismatch between selected edges and selected faces | Base Functionality | 19.0 F000 |
| 2114184 | Drawlist is cleared forcibly when mouse cursor snapped any 2D element during trim for infinite construction line. | Base Functionality | 19.0 F000 |
| 2114291 | [18.1-B010]:Save sd_qat_contents.lsp file (saved from 18.0) causes 18.1 to crash on startup. Loads successfully in 18.0. Modifying 18.1 Quick Access Toolbar and saving will always fail to be loaded successfully. | Base Functionality | 19.0 F000 |

| 2114408 | Cannot change color for 2D geometry in an inactive workplane | Base | 19.0 F000 |
|---------|--|-----------------------|-----------|
| 2111100 | | Functionality | 10.01.000 |
| 2115388 | Creo Elements/Direct Modeling 18.1 fails to start when reading sd_ribbon.lsp on non-image commands added to a ribbon tab / group | Base Functionality | 19.0 F000 |
| 2116613 | Pull Linear - Remove Material command creates swept B-spline surfaces (B-spline curve edges) but they should be circular curve edges. | Base Functionality | 19.0 F000 |
| 2117505 | Viewport > View By setting Fit Workplane Border does not work for the command "View by Curr WP". It works with "View by any WP". Per the help file, it should work with and "View by Workplane" command. | Base Functionality | 19.0 F000 |
| 2118422 | With a lot of geometry on the workplane, mini toolbar and selection of area take a lot of time to appear in Creo Elements/Direct Modeling. | Base Functionality | 19.0 F000 |
| 2121763 | Files of type pkg and sdexp do not load in Modeling 18.0 | Base Functionality | 19.0 F000 |
| 2122061 | Using Synchronized viewports with long parts and SpaceMouse views are out of sync shortly in Creo Elements/Direct Modeling 18.0 | Base Functionality | 19.0 F000 |
| 2122348 | Wrong display with "Enhanced Realism" and "Perspective" in certain model positions | Base Functionality | 19.0 F000 |
| 2122627 | The sequence "Undo" and "Delete 2D" stopped working in Modeling | Base Functionality | 19.0 F000 |
| 2123525 | Workplane "On Face" command fails and Modeling stopped working in 17.x, 18.x and 18.1 | Base Functionality | 19.0 F000 |
| 2123865 | Export of the viewport content ignores lower cases in file name if no extension is used | Base Functionality | 19.0 F000 |
| 2124410 | "Runtime error R6025-pure virtual function call" while customizing ribbons | Base Functionality | 19.0 F000 |
| 2124586 | The activation of the goodie "create_thumbnail" opens the load dialog instead of the "create thumbnail" dialog | Base Functionality | 19.0 F000 |
| 2124656 | When creating a thumbnail the filename (thumb1.jpg) will be ignored and only .JPG appears | Base Functionality | 19.0 F000 |
| 2126859 | Extreme Number of File accesses when working with Modeling 18.1 (open a ribbon tab takes several seconds) | Base Functionality | 19.0 F000 |
| 2129379 | Working with Full Screen F11 The Right Mouse context menu doesn't disappear if clicking ESC. | Base Functionality | 19.0 F000 |
| 2129516 | If a part/group that has not to be modify is hidden during the modify operation on another part, it automatically unhide. Beyond, even if the part unhides in the part list it appears un-flagged. | Base Functionality | 19.0 F000 |
| 2131746 | The "Pull Linear" command used in a lisp file has stopped working in Modeling | Base Functionality | 19.0 F000 |
| 2132130 | When the character of the last of a directory name is "=", it cannot load and cannot save | Base Functionality | 19.0 F000 |
| 2132261 | In customized Annotation strange behaviour of Sketch commands in Creo Elements/Direct Modeling 18.1 | Base Functionality | 19.0 F000 |
| 2132717 | How can a cross section be created with construction lines? | Base Functionality | 19.0 F000 |
| 2136433 | Define a "cross section" and then select some faces to move leads to the error "LISP error: NIL is not a structure" | Base Functionality | 19.0 F000 |
| 2136831 | Pressfit does not set the modify flag to parent assembly even if mark is assigned to Instance | Base Functionality | 19.0 F000 |
| 2136997 | Using File, Customize, FEA to Modify an existing command the system issues an error and restarts | Base Functionality | 19.0 F000 |

| 2137062 | Japanese menu's option name "offset" is not correct on "Shell Faces" dialog in Creo Elements/Direct Modeling 18.10 | Base Functionality | 19.0 F000 |
|---------|---|-----------------------|-----------|
| 2137682 | Clash color is always displayed in a clipping plane. Clash Color check box found int Viewport Settings dialog box has no effect. | Base Functionality | 19.0 F000 |
| 2137824 | Creating an arc on a WP with CoPilot using Cartesian Coordinates causes signal error | Base Functionality | 19.0 F000 |
| 2139029 | "Fatal exception error" when moving a drill hole and on new position overlaps another hole | Base Functionality | 19.0 F000 |
| 2139242 | Increase of memory when Rendering module is active and dynamic operations are executed | Base Functionality | 19.0 F000 |
| 2139373 | 3Dconnexion devices (Space Pilot, Space Explorer) does not work correctly in Modeling 18.1 | Base Functionality | 19.0 F000 |
| 2139628 | Sometimes a *.sdexp file is loaded correct and sometimes parts are missing | Base Functionality | 19.0 F000 |
| 2139810 | The edges of an active part are displayed in different colours | Base Functionality | 19.0 F000 |
| 2141238 | Selection of an assembly by drawing a box needs too much time. | Base Functionality | 19.0 F000 |
| 2141512 | Mirror Part of a symmetric counter nut with option "Check for symmetry" causes Modeling to stop working | Base Functionality | 19.0 F000 |
| 2142685 | Partially selected parts by a box to be removed from the drawlist fails with an error. | Base Functionality | 19.0 F000 |
| 2143903 | Missing example in Integration Kit documentation for the dialog "sd-fluentui-add-ribbon-group" | Base Functionality | 19.0 F000 |
| 2144415 | SDDONTSTOREUILAYOUTFILES and SDDISALLOWINTERACTIVECUSTOMIZATION have no effect on Ribbons and on Command Mini toolbars (CMT) customization. | Base Functionality | 19.0 F000 |
| 2144433 | Unneeded error message when adding a new ribbon via customization. Unknown Ribbon Parent: ("TEST" "Custom_Group_1") | Base Functionality | 19.0 F000 |
| 2145007 | Part checker for specific part runs into endless loop | Base Functionality | 19.0 F000 |
| 2147233 | After change of displayed number of decimal places in System Settings Measure: View by Face and Center doesn't work | Base Functionality | 19.0 F000 |
| 2148256 | The "sd_avail_cmds.cmd" commands should be localized. | Base Functionality | 19.0 F000 |
| 2148412 | The coordinate system attached to assembly will be hidden together when a child parts of assembly has been hidden. | Base Functionality | 19.0 F000 |
| 2149793 | *Transition* Sub-assemblies get modify flags when positioning included parts while a Configuration under the Top-assembly is activated. (Original: The sub-assemblies get modify flags when creating a configuration under the Top-assembly and positioning the part.) | Base Functionality | 19.0 F000 |
| 2150441 | *Transition* Signal received during load: Segmentation violation | Base Functionality | 19.0 F000 |
| 2154223 | The use of the TAB button to step through recognized feature leads to an endless loop. | Base Functionality | 19.0 F000 |
| 2154322 | Wrong graphical display of conical surfaces. | Base Functionality | 19.0 F000 |
| 2155648 | *Transition* A pkg file created in Modeling Version 11.0 cannot be loaded into 18.1 (sigsegv) | Base Functionality | 19.0 F000 |
| 2157072 | Regression: The Symmetrical Move command doesn't work and gives a Lisp error. | Base Functionality | 19.0 F000 |
| 2159316 | Fatal error occurs when moving a face and Modeling stops working | Base Functionality | 19.0 F000 |

| 2159458 | Cut of machining feature stanped working in Medaling | Paca | 19.0 F000 |
|---------|---|-----------------------|-----------|
| 2159456 | Cut of machining feature stopped working in Modeling | Base Functionality | 19.0 -000 |
| 2159856 | Poor performance when loading 2D geometry into a workplane or when removing the workplane | Base Functionality | 19.0 F000 |
| 2159890 | A package file cannot be loaded into Modeling. Runs into an endless loop. | Base Functionality | 19.0 F000 |
| 2159965 | Unable to load a package file | Base Functionality | 19.0 F000 |
| 2160288 | After modifying existing ribbon tabs, e.g. adding commands or groups or hiding them, the ribbon tab cannot be accessed via the Alt key. | Base Functionality | 19.0 F000 |
| 2160320 | Modeling stopped working when deactivating the module ModelManager via input line in Modeling | Base Functionality | 19.0 F000 |
| 2161230 | Error "Vport1 frozen due to Graphics Error" appears by adding a specific part to Drawlist. | Base Functionality | 19.0 F000 |
| 2161852 | Regression: Mirror command fails with error message: Cannot mirror the selected object because at least one child is read-only | Base Functionality | 19.0 F000 |
| 2163363 | Data loss - Regression: Add configuration to Annotation view does not force the modify flag in the structure browser of the model | Base Functionality | 19.0 F000 |
| 2164149 | Hidden commands as part of a long toolbar doesn't work | Base Functionality | 19.0 F000 |
| 2164401 | In Modeling Subtract removes WGM attributes from the blank part if the tool owns the same attributes | Base Functionality | 19.0 F000 |
| 2165998 | A Model Manager file "*.SD" cannot be loaded into Modeling. A system crash is the result. | Base Functionality | 19.0 F000 |
| 2166477 | Add Loft has stopped working in Modeling | Base Functionality | 19.0 F000 |
| 2166994 | Inseparable command leads to a "sigsegv" error. | Base Functionality | 19.0 F000 |
| 2167894 | Command group appears two times when minimizing the Ribbon UI | Base Functionality | 19.0 F000 |
| 2169387 | Part can own another part if the correct sequence is selected while sharing or copying a part. | Base Functionality | 19.0 F000 |
| 2169666 | The Move 3D of a face leads to a system hang | Base Functionality | 19.0 F000 |
| 2172011 | An imprinted edge should be moved by using Stretch-Edge command. Modeling stopped working. | Base Functionality | 19.0 F000 |
| 2172485 | "Select current" command stopped working in Modeling | Base Functionality | 19.0 F000 |
| 2176224 | Modeling has stopped working when loading an *.sdexp into Modeling 18.1 | Base Functionality | 19.0 F000 |
| 2179044 | Tool "cleanup_udef.dll" cannot be loaded into Modeling 18.1 | Base Functionality | 19.0 F000 |
| 2180435 | Cut Faces leads to an endless loop in Modeling | Base Functionality | 19.0 F000 |
| 2181478 | Move a face of a non-manifold part stopped working in Modeling | Base Functionality | 19.0 F000 |
| 2182236 | The load/save file browser does not remember configured view settings when running on Windows 7 or Windows Vista | Base Functionality | 19.0 F000 |
| 2182604 | deactivate the restart of Modeling after a system crash | Base Functionality | 19.0 F000 |
| 2182690 | LISP Error when selecting an assembly on browser in Modeling | Base Functionality | 19.0 F000 |
| 2182908 | Rendering: Adding a new decal (image) leads to a segmentation violation | Base Functionality | 19.0 F000 |

| 2183221 | Export of a model in Granite 5 format leads to an error in Modeling 18.1 | Base Functionality | 19.0 F000 |
|---------|--|----------------------------|-----------|
| 2183406 | A Chain Selection doesn't allow to modify the radius of single edges during Blend Creation | Base Functionality | 19.0 F000 |
| 2185707 | Pull Angular command stopped working in Modeling | Base Functionality | 19.0 F000 |
| 2186069 | Custom commands loaded by the sd-available-commands file are greyed out in the ribbon UI. The ribbon does not update after these files are loaded like the toolbars to. | Base Functionality | 19.0 F000 |
| 2186236 | Modeling stopped working when adding the Recorder to the Quick Access Toolbar | Base Functionality | 19.0 F000 |
| 2187770 | "Fatal exception error" will be displayed when moving 4 faces in Modeling | Base Functionality | 19.0 F000 |
| 2191342 | chk_open_ref_del.dll has stopped working in Modeling 18.1M040 | Base Functionality | 19.0 F000 |
| 2195364 | Creo Elements/Direct Modeling becomes unresponsive when closing dialog message for equidistance | Base Functionality | 19.0 F000 |
| 2201397 | When deleting view labels by normal Delete command, the warning will be displayed but it's not localized for Japanese Creo Elements/Direct Modeling 18.10. | Base Functionality | 19.0 F000 |
| 2212771 | If a new group is added to a ribbon by the Annotation side, the new group added to the ribbon of Modeling is not loaded at a start-up next time. | Base Functionality | 19.0 F000 |
| 2098317 | Part Library: Documentation missing for dialog "Hatch Roller Body" | Documentation | 19.0 F000 |
| 2116801 | Only one video doesn't start from Quickstart project of Japanese. The link URL is: http://download.ptc.com/products/creo-elements-direct/18- | Documentation | 19.0 F000 |
| 2128105 | O/japanese/modeling/video/Create_Profile/Create_Profile.html Invalid (dead) link to www.ptc.com/products/creo-elements/direct in Readme.html in the installation package | Documentation | 19.0 F000 |
| 2133953 | Invalid translation in German Online Help: Chapter "Move a sketch and change the owner" is wrongly translated as: Skizze bewegen und Benutzer andern | Documentation | 19.0 F000 |
| 2188354 | Help of Creo Elements/Direct Modeling cannot be started with Windows 8 | Documentation | 19.0 F000 |
| 2195481 | SET_RELATIONS documentation in the Commands Reference Manual in the help files contains spelling errors In the Example showing how to use the function SET_RELATIONS is spelled as SET_RELATION in four places | Documentation | 19.0 F000 |
| 2083539 | Results of a Thermal Analysis Passed to a Linear Static Analysis Lead to Wrong Deformation Results | Finite Element Analysis | 19.0 F000 |
| 2092749 | Creo Elements/Direct Modeling FEA - Deleting a Mate Relation does not remove the selected one | Finite Element Analysis | 19.0 F000 |
| 2192124 | When KB2856758 and KB2845533 are installed in Windows 8 by Windows Update, Creo Elements/Direct Modeling 18.10 M030 and M040 doesn't launch. | Installation | 19.0 F000 |
| 1774343 | Severe issues importing a large assembly via IGES - missing parts - compare with Pro/E results | Interfaces 3D | 19.0 F000 |
| 1960910 | Failed to generate a valid STEP file. reproduced with 17.0 BETA 3 | Interfaces 3D | 19.0 F000 |
| 1976556 | Pro/E Granite Interface does not Ex-/-Import the Instance Color as expected | Interfaces 3D | 19.0 F000 |
| 2040728 | Creation of STEP file fails with "Unable to create valid STEP File" | Interfaces 3D | 19.0 F000 |
| 2054992 | importing IGES file is very bad performance | Interfaces 3D | 19.0 F000 |

| 2055742 | Importing STEP data leads to segmentation violation. | Interfaces 3D | 19.0 F000 |
|---------|---|-----------------------|-----------|
| 2056982 | In attached PKG file is not exported it to a IGES (new version) file but get failed. | Interfaces 3D | 19.0 F000 |
| 2085822 | P-XVL (*.xv3) Export leads to the error "Export failed" | Interfaces 3D | 19.0 F000 |
| 2104170 | Native Granite Import failed when importing .prt file created by Creo Elements/Pro (Pro/ENGINEER). | Interfaces 3D | 19.0 F000 |
| 2114030 | Incorrect weight in due to reference parts. | Interfaces 3D | 19.0 F000 |
| 2121660 | Modeling Configurations containing drawlist definitions are not respected in Creo View | Interfaces 3D | 19.0 F000 |
| 2124292 | Multi byte attribute name/value in the exported pvz file from Creo Elements/Direct Modeling are garbled. | Interfaces 3D | 19.0 F000 |
| 2125072 | "Modeling has stopped working" when loading a large STEP file (approx. 600 MB) | Interfaces 3D | 19.0 F000 |
| 2125470 | Unable to open the STEP and PRT/ASM files using Granite stored directory path with the Chinese characters, but PKG and ANF files are ok | Interfaces 3D | 19.0 F000 |
| 2127297 | Attached STEP file is not getting opened in Creo Elements/Direct with direct option On behalf of GRANITE customer- Codeware) | Interfaces 3D | 19.0 F000 |
| 2127996 | Granite import fails with error message "Native Granite Import failed" | Interfaces 3D | 19.0 F000 |
| 2128830 | Creo Elements/Direct Modeling hangs on save operation when saving model and preview file in one step | Interfaces 3D | 19.0 F000 |
| 2130035 | Loading huge assembly (size of 3D Models > 300 m) into Product View leads to unexpected and incorrect simplification of Cylinder shaped parts. | Interfaces 3D | 19.0 F000 |
| 2136267 | Opening a PVZ file that was exported from Creo Elements/Direct Modeling 18.1 in Creo View 2.0 | Interfaces 3D | 19.0 F000 |
| 2137825 | SAT Export of a large assembly from Creo Elements/Direct Modeling does not terminate | Interfaces 3D | 19.0 F000 |
| 2140774 | Creo Elements/Direct Modeling fails to load a part.prt from Pro/ENGINEER Wildfire5 | Interfaces 3D | 19.0 F000 |
| 2153736 | Creo Parametric parts from family table are incorrectly transferred to Creo Elements/Direct Modeling | Interfaces 3D | 19.0 F000 |
| 2178250 | Load of STEP file from AutoCAD 2010 results in corrupt part | Interfaces 3D | 19.0 F000 |
| 2180413 | Saving a part to Creo View MCAD .pvz format causes endless loop | Interfaces 3D | 19.0 F000 |
| 2195253 | In the environment of Chinese Simplified or Traditional, open the .pvz file in Creo View 2.0 which was exported from Creo Elements/ Direct 18.1, the part name in structure will be messy code | Interfaces 3D | 19.0 F000 |
| 2195293 | Parts are missing in Creo Elements/Direct Modeling after importing an IGES3D file | Interfaces 3D | 19.0 F000 |
| 2195919 | Step export leads to segmentation violation and Modeling stopped working | Interfaces 3D | 19.0 F000 |
| 2205652 | Long loading / translation time when opening a large Creo Elements Direct Modeling (CoCreate Solid Designer) assembly with Creo Parametric | Interfaces 3D | 19.0 F000 |
| 2191428 | User gets no SAP ERP license although being logged in as stated in the access list of the License server - License server does not tolerate capital/small caps letter. License server expects same login name in session as set in the Windows active directory. Windows itself does not care about capital/small caps letters. | Licensing | 19.0 F000 |
| 2100765 | The error occurred stepped hole create or modify behaviour. | Machining Features | 19.0 F000 |
| 2152767 | after upgrading Modeling 18.10, machining customization doesn't | Machining | 19.0 F000 |

| | work with LISP error | Features | |
|---------|--|---------------------------|-----------|
| 2161983 | Modeling clashes with Modify command of Machinig | Machining Features | 19.0 F000 |
| 2168734 | Modeling has stopped working when modifying a machining feature. | Machining Features | 19.0 F000 |
| 2152405 | After save drawing to database points occur outside of the drawing frame in Annotation | Model Manager Integration | 19.0 F000 |
| 2154970 | *Transition* Parts inside Inseparable are modified when loaded into Modeling V18.1 | Model Manager Integration | 19.0 F000 |
| 1873366 | UNF thread dimensions not displayed correctly | PartLibrary | 19.0 F000 |
| 1927484 | List of all implemented standards in PartLibrary is missing'. | PartLibrary | 19.0 F000 |
| 1935711 | [17.0]: [BETA2] Use of PartLibrary 17.0 Beta2 template "original" to save model into PartLibrary catalogue can lead to two elements in Model Manager with same SYSID - one in MODEL_3D the other in LIBRARY_3D | PartLibrary | 19.0 F000 |
| 1999115 | SDVERSIONDEPCUSTOMIZEDIRS = 1 does not work with PartLibrary? | PartLibrary | 19.0 F000 |
| 2059161 | Part Library: Some menu button's names of Spring Pins are not correct in Japanese. This is an issue of localization for Japanese Creo Elements/Direct. | PartLibrary | 19.0 F000 |
| 2084639 | When copying a screw connection in a part, the error is generated. Action failed. Perhaps the Part/Assembly xxx has no write access. | PartLibrary | 19.0 F000 |
| 2086973 | Changes of attribute "Material" in Part Library (SolidPower) are not reflected in Model Manager | PartLibrary | 19.0 F000 |
| 2099150 | Too many decimal places displayed in Part Library's 'List of Drillings' for Machining drills | PartLibrary | 19.0 F000 |
| 2099186 | Wrong language in Type column of Part Librariy's List of Drillings for Machining drills in Creo Elements/Direct Modeling 18.0 M010 | PartLibrary | 19.0 F000 |
| 2100283 | Annotation's Part Library command to Move Position Flags performs a Move Target command | PartLibrary | 19.0 F000 |
| 2100583 | PL: Feathers keys - The function WP-cyl-const does not exist anymore in 18.0 | PartLibrary | 19.0 F000 |
| 2129375 | Not able to open Additional Information documents stored for a Part Library catalog group if the catalog is tied in using a UNC path | PartLibrary | 19.0 F000 |
| 2137216 | Unclear why there is a Spring type straight pin DIN EN 28752 Type A and Type B. EN ISO 8752 is not separated in Type A or B | PartLibrary | 19.0 F000 |
| 2138563 | Old Part Library DIN EN 24032 and DIN EN 24014 | PartLibrary | 19.0 F000 |
| 2156609 | The error message is not appropriate when creating a drill of Part Library for the part. | PartLibrary | 19.0 F000 |
| 2165453 | [Part Library] New sink table is not created on specified Machining group. | PartLibrary | 19.0 F000 |
| 2169360 | Load a disc several times and position it on top of the previous one this stopped working in Modeling | PartLibrary | 19.0 F000 |
| 2209111 | PartLibrary cannot hide the rows which have "x" in the "DELETE" column from company part table | PartLibrary | 19.0 F000 |
| 1742474 | Modify Corner Relief returns (sha_modify_feature/signal/sigsegv) or endless loop | Sheet Metal | 19.0 F000 |
| 1977886 | The move of a sheet feature in dirY leads to the error "Error while inserting new stamp". All other dir. works well. | Sheet Metal | 19.0 F000 |
| 1989233 | "Add Lip" by CoCreate Modeling V17 doesn't work correctly. The shape of the sheet part will be changed badly. | Sheet Metal | 19.0 F000 |
| 2029926 | Sheet Metal: Unfold of a sheet metal part ignores the option "Both Sides" | Sheet Metal | 19.0 F000 |

| 2062378 | Wrong representation of the bend line in a flat view (Annotation) | Sheet Metal | 19.0 F000 |
|---------|--|---|-----------|
| 2067402 | Add Lip removes unexpected material | Sheet Metal | 19.0 F000 |
| 2069986 | Using bend face as base face with option "both sides" creates wrong corner display | Sheet Metal | 19.0 F000 |
| 2071086 | Add Lip on both edges (top and bottom) of a plane leads to a sigsegv error | Sheet Metal | 19.0 F000 |
| 2075824 | Creating a flat view the system displays angles like 77.919 | Sheet Metal | 19.0 F000 |
| 2077059 | Flat View creation from sheet with a cut-out blended on both sides not possible | Sheet Metal | 19.0 F000 |
| 2079317 | Modeling crash - Add Lip on both edges (top and bottom) of a plane leads to a sigsegy error | Sheet Metal | 19.0 F000 |
| 2091506 | Stretch Lip may create a faulty result if the adjacent faces are not orthogonal to the bend | Sheet Metal | 19.0 F000 |
| 2098143 | Flat view of a specific sheet part saved in Modeling 16.50 rotates during view update in Creo Elements/Direct Modeling 17.0 and 18.0 | Sheet Metal | 19.0 F000 |
| 2105352 | Lip creation on a specific sheet part fails with a customized shop file with error message - Error message: Problem creating left corner relief: You must enter a positive number | Sheet Metal | 19.0 F000 |
| 2115088 | Modification of bend leads a wrong bend angle. | Sheet Metal | 19.0 F000 |
| 2116397 | Modify Feature fails with error message on a shared part if another share of it is set active | Sheet Metal | 19.0 F000 |
| 2117498 | Large radius (48.125") fails to unfold, throws an error | Sheet Metal | 19.0 F000 |
| 2120710 | Option Both Sides during creation of a Annotation flat view does not work if all edges of the Sheet Metal part are furnished with chamfers | Sheet Metal | 19.0 F000 |
| 2131382 | Using Basic Sheets - Unfold - give the error message: Creo Elements/Direct Modeling has stopped working, close program. When first using Refold then Unfold no error happens | Sheet Metal | 19.0 F000 |
| 2131659 | The tooltip for the command Fold/Unfold is incorrect. The contents of the tooltip is "Folds and unfolds parts" which is not correct. The command actually does a Fold or Unfold bend. In revision 17 the tooltip was only Fold/Unfold which at least is not wrong. | Sheet Metal | 19.0 F000 |
| 2140445 | The keyword :Handle doesn't work correctly when creating a sheet part by using "New by outline" | Sheet Metal | 19.0 F000 |
| 2141528 | Modeling stopped working when removing a sheet metal feature | Sheet Metal | 19.0 F000 |
| 2148163 | Wrong position of a stamp feature in a flat view after stretching the part | Sheet Metal | 19.0 F000 |
| 2157653 | The same stamp tool leads to different results | Sheet Metal | 19.0 F000 |
| 2160730 | Bend Creation leads to a corrupt part | Sheet Metal | 19.0 F000 |
| 2168351 | An own defined punch tool has stopped working in Modeling | Sheet Metal | 19.0 F000 |
| 2168753 | An own defined punch tool has stopped working in Sheet Metal | Sheet Metal | 19.0 F000 |
| 2168932 | Changing sheet_metals name in sha_demoshop.lsp causes error when using New by Outline command. | Sheet Metal | 19.0 F000 |
| 2171593 | Add Lip on a sheet metal part containing an open chain of imprinted edges leads to an error. | Sheet Metal | 19.0 F000 |
| 2200822 | Add Lip on both edges of a plane leads to a sigsegv error and Modeling hangs | Sheet Metal | 19.0 F000 |
| 2138874 | 18.x Skinning rejects a certain mesh it accepted in version 17.0 M040 | Surfacing | 19.0 F000 |
| 2117396 | Need the possibility to format the date delivered in PTC_WM_CREATED_ON and PTC_WM_MODIFIED ON for displaying it in a text reference | Workgroup Manager for Creo Elements/Direct | 19.0 F000 |

| | | Modeling | |
|---------|---|---|-----------|
| 2118863 | "Attach drawing to Copy" command does not duplicate a drawing when it is saved to workspace with Workgroup Manager for Creo Elements/Direct Modeling | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2120568 | Modeling crashes with several pkg-files | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2154968 | Workgroup Manager for Creo Elements does not recognize duplicate Library Parts | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2172334 | On German OS date format in Annotation text reference only shows weekday when using sd-uwgm-tr-register-date-attribute and sd-uwgm-tr-set-date-format "DD/MON/YYYY" :format-always :on) | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2172728 | Inseparable Assembly as Library object causes error: Update failed as a result of an error in Cad tool | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2172858 | Company library parts show error: "Update failed as a result of an error in Cad tool" when checking in or clearing workspace in WGM for Creo Elements/Direct Modeling | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2172864 | Problem registering annotation frames in Windchill library The frame becomes a dummy frame when creating a new drawing with it | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2173640 | sd-uwgm-inq-modified returns always true. How can be inquired if an element is modified or not | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2175899 | Documentation for sd-uwgm* LISP functions is missing | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2180851 | Attach drawing to copy fails with "Action failed am_attach_drawing_to_copied_part_olny/signal/sigsegv" when using attached drawing and model when WGM is active | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 F000 |
| 2180854 | When creating drawings including flat views wrong references are created in Windchill | Workgroup Manager for Creo Elements/Direct | 19.0 F000 |

| | | Modeling | |
|---------|--|---|--------------|
| 2079149 | Update of Flat View takes much longer than initial view creation | Annotation | 19.0 M010 |
| 2149543 | Bounding bog (frame) of a view grows when switching the update mode from Classic/Graphics to Classic/Graphics + Shaded | Annotation | 19.0 M010 |
| 2226516 | Regression: Unexpected deletion of registered symbols, texts and sketches using "sd-am-unregister-symbol" | Annotation | 19.0 M010 |
| 2227675 | Pictures won't be printed in Creo Elements/Direct Modeling 19.0 F000 | Annotation | 19.0 M010 |
| 2224955 | Please add special characters Trademark <alt>+0153 and Registered <alt>+0174 to osd_default font</alt></alt> | Annotation | 19.0 M010 |
| 2101633 | The part checker displays the error: "Geometric evaluation of edge fails. The part is corrupt" | Base Functionality | 19.0 M010 |
| 2179718 | Browser customization working in revision 16 shows wrong pseudo folder name | Base Functionality | 19.0 M010 |
| 2197332 | Modeling 18 and 18.1 fails to load any SD File > 4GB | Base Functionality | 19.0 M010 |
| 2213210 | Having structure browser undocked switch back to Modeling drawing browser appears on the left side of Modeling | Base Functionality | 19.0 M010 |
| 2216365 | High Resolution Print creates a black image when using the CoCreate convert.exe | Base Functionality | 19.0 M010 |
| 2227045 | Premature exit after click close button of Error Dialog for Cross Construction lines. | Base Functionality | 19.0 M010 |
| 2227552 | Online Help is not complete in Modeling 19.0 | Base Functionality | 19.0 M010 |
| 2238378 | When creating a new command in Customize Ribbon dialog, Icon File not found. Check the file name and try again. is displayed and command creation fails if the icon file name includes multibyte characters or the folder name includes multibyte characters where | Base Functionality | 19.0 M010 |
| 2150134 | Creo Element/Direct Modeling 18.10 M010 hangs when cutting multiple machining features with Next option | Machining Features | 19.0 M010 |
| 2199867 | SheetMetal: Revers Dir button doesn't change the direction of the arrow | Sheet Metal | 19.0 M010 |
| 2226990 | 19.0 New command: Creating a Cut Slot to open sheetmetal part, the slot line remains when Cancel is pressed. | Sheet Metal | 19.0 M010 |
| 2228310 | Incorrect flat view when the height of the Offset is smaller than the material thickness. | Sheet Metal | 19.0 M010 |
| 2207258 | Wrong representation (Duplicated geometry) of selective instances of Creo Elements / Direct Modeling 18.1 | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 M010 |
| 2225789 | Performance decrease with sheet metal functionality when WGM is active | Workgroup Manager for Creo Elements/Direct Modeling | 19.0 M010 |
| 2228233 | When moving views or text entities in Annotation 19.0 the viewport will show a white flash in addition | Annotation | 19.0 M020 |
| 2239874 | Front and Up Direction can't be defined in Annotation (Regression) | Annotation | 19.0 M020 |
| 2240229 | Line or Dot grid not visible in Creo Elements/Direct Modeling Annotation version 19.0. | Annotation | 19.0 M020 |

| | T | Ι | T |
|--------------|--|--------------------|--------------|
| 2249006 | Modeling hang when changing view properties to Graphics + | Annotation | 19.0 |
| 0475700 | Shaded and Photo-Realistic error "Escape from action routine" | 5 | M020 |
| 2175798 | The German translation of "Infinite construction line cross" which is | Base | 19.0 |
| | "Unendliche Hilfslinie quer" is misleading and should show that the | Functionality | M020 |
| 0007504 | centre point can be caught. | Dana | 40.0 |
| 2227584 | VP Frame becomes invisible after creation of cross construction | Base | 19.0 |
| 0000705 | lines. | Functionality | M020 |
| 2238785 | UI setting Button Trigger > On Push causes any function selected | Base | 19.0 M020 |
| 2240425 | from a toolbar to run twice. (On Push AND On Release) | Functionality Base | |
| 2240125 | Signal received when executing sd-inq-exact-box with a specific part | Functionality | 19.0 M020 |
| 2240512 | Modified Flag is not set while changing owner of a stock/finish | Base | 19.0 |
| 2240012 | relation | Functionality | M020 |
| 2241121 | Structure browser can't be positioned independently in Creo | Base | 19.0 |
| 2211121 | Elements/Direct Modeling (regression) | Functionality | M020 |
| 2241301 | No selection box when using construction crosses in Creo | Base | 19.0 |
| | Elements/Direct Modeling (regression) | Functionality | M020 |
| 2248819 | Regression: Slow performance when the Fly-By option is enabled | Base | 19.0 |
| - | , | Functionality | M020 |
| 2246778 | Explanation for supported version for importing SolidWorks file is | Documentation | 19.0 |
| | not updated in Japanese Help document | | M020 |
| 2248185 | Creo Elements/Direct Modeling shows strange behaviour during | Model Manager | 19.0 |
| | storage process | Integration | M020 |
| 2201261 | Import of STEP file fails with no error in Modeling | Interfaces 3D | 19.0 |
| | | | M020 |
| 2238649 | Parts are missing (without warning) when importing SolidWorks files | Interfaces 3D | 19.0 |
| | *.SLDASM into Modeling 19.0 | | M020 |
| 2239854 | Imported sldprt has incorrect shapes in Modeling | Interfaces 3D | 19.0 |
| | | | M020 |
| 2240514 | SolidWorks file ".SLDASM" cannot be loaded directly into Modeling | Interfaces 3D | 19.0 |
| | 19.0 | | M020 |
| 2251116 | Error message "translation of native format failed" when loading or | Interfaces 3D | 19.0 |
| | saving IGES | | M020 |
| | or SAT File Types in Creo Elements/Direct Modeling 19.0 on some | | |
| 0004000 | systems Department of the second of the seco | Ob a at Matal | 40.0 |
| 2221932 | Modeling has stopped working when using Punch command in Sheet Metal | Sheet Metal | 19.0 M020 |
| 2243317 | Unfold 2D of a tube has stopped working in Modeling | Sheet Metal | 19.0 |
| 2243317 | Official 2D of a tube has stopped working in Modeling | Sheet Metal | M020 |
| 2246464 | A dialog of "Open from Windchill" is not displayed when "Open from | Workgroup | 19.0 |
| 2240404 | Windchill" of Annotation is performed on Creo Elements/Direct | Manager for | M020 |
| | Modeling. | Creo | 101020 |
| | A dialog of "Open from Windchill" is displayed when "Open from | Elements/Direct | |
| | Windchill" of Modeling is performed on Creo Elements/Direct | Modeling | |
| | Modeling. | | |
| 4414203 | Storing back a bolt circle in Creo Elements/Direct Modeling will | Annotation | 19.0 |
| | lead to improper data | | M030 |
| 4506459 | Hatches are missing | Annotation - | 19.0 |
| 4300433 | Hatches are missing | | |
| | | Hatch | M030 |
| 2822218 | Hatch disappears or changes colour depending on hatch distance – | Annotation - | 19.0 |
| | Regression happens in Modeling and Drafting from 19.0 M020 on | Hatch | M030 |
| 2821434 | Latest version of osd_default font has not be not implemented in | Annotation - | 19.0 |
| | | | |

| 2818645 | Require a tool to change the Symbolic_Name and version for Creo | Base | 19.0 |
|---------|---|-----------------------------------|--------------|
| | Elements/Direct Modeling. | Functionality - Modeling | M030 |
| 2821980 | Certain hatch patterns will disappear when performing window zoom in Annotation (regression) | Graphics - Drafting | 19.0 M030 |
| 4463934 | "Container" is NOT loaded in Creo Illustrate when its name contains special characters (") | Interfaces 3D | 19.0 M030 |
| 2821577 | Regression: Update destroys a flat view and leads to wrong dimensions | Sheet Metal | 19.0 M030 |
| 4591825 | Missing lines in a Flat View containing imprinted edges, as A, b, e, g etc. | Sheet Metal - Fold/Unfold | 19.0 M030 |
| 2821818 | Regression: Flat view creation stopped working in 19.0 | Sheet Metal - Fold/Unfold | 19.0 M030 |
| 2820569 | Regression: Not each shortcut will be removed automatically from the Modeling command line | User Interface - Customization | 19.0 M030 |
| 2820539 | Regression: Wrong dimension measured when moving a face by using anchor points. | User Interface - Modeling | 19.0 M030 |
| 2817487 | When WGM preference "Default Drawing Frame Location" is defined wrong, e.g. with a slash in front of Library Name, the save to workspace fails with "Save to WorkspaceFailed". Is it possible to display a more meaningful message? | WGM for Modeling | 19.0 M030 |
| 2822171 | Using a certain Drawing Template will cause Lisp error in Creo Elements/Direct Modeling | Annotation | 19.0 M040 |
| 4393580 | Dimension tangential when setting option vertical it is impossible to set the dimension | Annotation | 19.0 M040 |
| 4805285 | When executing "Bom Scan Model" for the assembly which includes a sub assembly with "All Levels" option, the error is generated in Creo Elements/Direct ModelingDescription when executing Bom | Annotation | 19.0 M040 |
| 2821013 | Sigseg error during view update of a section view in Creo Elements/Direct Modeling | Annotation - View Update | 19.0 M040 |
| 4572554 | Detail view prevents update - Modeling hangs | Annotation - View Update | 19.0 M040 |
| 2821726 | PVZ export does not contain database information when no direct connection to Model Manager is established. | Interfaces 3D - Creo | 19.0 M040 |
| 2819357 | Regression: Using Modeling Help through a UNC path the table of contents is not displayed correctly - worked fine in rev. 18.1 | Modeling | 19.0 M040 |
| 2821456 | How can I configure the Modeling Worker so the .mi drawings are created in in black and white pdf? The pdfs are currently in colour. | Plot / Print Modeling | 19.0 M040 |
| 4663646 | Drop Number File Extension does not work for Windchill Workgroup Manager for Creo Elements Direct Modeling 10.2 M010 | WGM for Modeling | 19.0 M040 |
| 4801556 | CEDM filesynchronized worker fails to publish some drawings to PDF in Windchill PDMLink | WGM for Modeling | 19.0 M040 |
| 5615463 | The original of circle planar surface is different with the centre of circular curve if save model file to STEP and import STEP file into Creo Elements/Direct Modeling again | Analysis & Checks | 19.0 M050 |

| 4547772 | Dimension feedback at viewport border wrong in Annotation | Annotation | 19.0 M050 |
|---------|---|-------------------------------------|--------------|
| 4562544 | Import a certain DWG file which only contains 2D data in modelspace will error messages in Annotation | Annotation | 19.0 M050 |
| 4916303 | Regression: DxfDwg translator doesn't run correctly when the mi file contains text with negative size | Annotation | 19.0 M050 |
| 4931105 | DWG File cannot be imported in Annotation because of logo used in the title block | Annotation | 19.0 M050 |
| 5277409 | Update of view containing coordinate dimension fails and Modeling becomes unresponsive in M040 where it works fine in M030 | Annotation - Dimension | 19.0 M050 |
| 2822228 | Hatching cannot be displayed on DXF/DWG files loaded into Annotation Version 19.0 M020.Regression issue. Worked correctly in Previous versions. Trying to move text in drawing that may be located over or under this | Annotation - Hatch | 19.0 M050 |
| 4561164 | Scale label of detail view has been removed at the time to change the style of view name | Annotation - View | 19.0 M050 |
| 5643821 | Scale views which created by using drawing template, the views' position will be shifted in Creo Elements/Direct Modeling 19.0 | Annotation - View | 19.0 M050 |
| 4913333 | Sigseg error during view update of a section view caused by a dimension in Creo Elements/Direct Modeling | Annotation - View Update | 19.0 M050 |
| 5162664 | Update fails due to detail and section views | Annotation - View Update | 19.0 M050 |
| 5224969 | sigsegv happened by updating a specific broken view | Annotation - View Update | 19.0 M050 |
| 4868196 | The geometry Properties Report for button surface and button edge of cylinder is different in Creo Elements/Direct Modeling 19.0 | Base Functionality - Modeling | 19.0 M050 |
| 4877693 | Need Info: Is there an easy way to inquire if a face is an inside or outside located face | Base Functionality - Modeling | 19.0 M050 |
| 4948913 | Unable to save model - error Action failed am_save_bundle/f2_core/unknown_error appears. | Base Functionality - Modeling | 19.0 M050 |
| 5596524 | After Copy the assembly file, Save Package for the copied the assembly file and delete copied the assembly file from current session, if Load saved pkg file into existing session, then the saved pkg file will far away from the original location. | Base Functionality - Modeling | 19.0 M050 |
| 4534243 | MI file version becomes 3.50 when Creo Elements/Direct Modeling 19.00 stores the mi file for Release 18.0 although the mi file version of 18.0 is 3.40. | Filing - Modeling | 19.0 M050 |
| 4620684 | Endless loop when saving assembly to Creo View MCAD (*.pvz) in Modeling | Filing - Modeling | 19.0 M050 |
| 4782951 | Exporting MI file to DWG will create zero-byte files in Creo Elements/Direct Modeling | Interfaces - DWG/DXF | 19.0 M050 |
| 4623138 | Cannot open specific Creo Elements/Direct pkg files | Interfaces 3D | 19.0 M050 |

| 4768163 | Unable to load or Save IGES or SAT | Interfaces 3D | 19.0 M050 |
|---------|---|------------------------------|--------------|
| 4907563 | Assigned colour are lost when open the part in Modeling | Interfaces 3D | 19.0 M050 |
| 2818141 | Create chamfer on attached threads in Part Library is possible but chamfers cannot be changed in Part Library although the function is available | PartLibrary | 19.0 M050 |
| 2818558 | Invalid Corner Relief when a stamp is present | Sheet Metal - Fold/Unfold | 19.0 M050 |
| 4673278 | Flat view is not complete if the sheet metal (or basic sheet) part contains blends or chamfer | Sheet Metal - Fold/Unfold | 19.0 M050 |
| 5583639 | Modeling stopped working when unfolding a sheet metal part in Creo Elements/Direct Sheet Metal | Sheet Metal - Fold/Unfold | 19.0 M050 |
| 4605919 | Library parts created in offline mode are not synchronized with existing same library part in Workgroup Manager for Creo Elements Direct Modeling | WGM for Modeling | 19.0 M050 |
| 4787868 | Creo Elements/Direct Modeling 18.1 M050 connected to Windchill workgroup manager exits while updating a large number of objects | WGM for Modeling | 19.0 M050 |
| 4798777 | Configurations in a Model are wrong when model is reverted | WGM for Modeling | 19.0 M050 |
| 5143092 | Error Failed to open in PTC Creo Elements/Direct Modeling 19.0 xxxxx.mi | WGM for Modeling | 19.0 M050 |
| 5145495 | Creo View Adapters 3.1 for Modeling initiates WWGM client UI while publishing even if the file sync is NOT enabled for the worker and the Workgroup Manager 11.0 is NOT enabled in Creo Elements/Direct Modeling. | WGM for Modeling | 19.0 M050 |
| 5223929 | Creo Elements/Direct Modeling 18.1 M050 connected to Windchill Workgroup Manager 10.2 M030 becomes unresponsive on workspace update | WGM for Modeling | 19.0 M050 |
| 5286437 | Open from Windchill of any model in maximized Creo Elements Direct Modeling 19.0 M040, makes the Modeling Window minimized to approx. 1600x900 px. | WGM for Modeling | 19.0 M050 |

©2016 PTC Inc. The information contained herein is provided for informational use and is subject to change without notice. The only warranties for PTC products and services are set forth in the express warranty statements accompanying such products and services and nothing herein should be construed as constituting an additional warranty. PTC shall not be liable for technical or editorial errors or omissions contained herein. Important Copyright, Trademark, Patent, and Licensing Information: See the About Box, or copyright notice, of your PTC software.